

Manhole Inspection Summary

Manhole # S39A__039MH

Printed On: 4/10/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39A** Node: **039** Status: **Found**

Insp Date: **11/29/07 9:27 AM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **mcelderry st**

Cross Street: **forrest st**

Manhole Type: **Junction** Location: **Parking Lot**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **pipe at 3 is way under a shelf**

Cover Shape: **Circular** Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)
5

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☐ Sound ☒ **Cracked** ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **D-Shape** Diameter: **36** (in.) Length: **36** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Unknown** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **7** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S39A__039MH

Printed On: 4/10/2009

Page 2 of 4

Location View



Top View




Misc.



bench debris

Defect 2

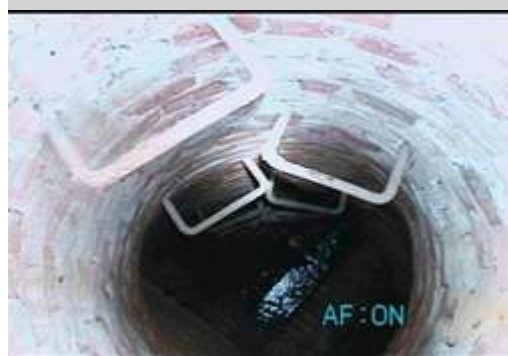

steps

Defect 3



CHIMNEY_COND_LOOSE_BRICKS

Defect 1



Frame cracked

Manhole Inspection Summary

Manhole # S39A__039MH

Printed On: 4/10/2009

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



12 is under shelf couldnt get better pic

Pipe Height: 0 (in.) Direct

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **11.70** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'clock



way under shelf cant get better pic

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.74** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S39A__039MH

Printed On: 4/10/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: 11.60 (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection